

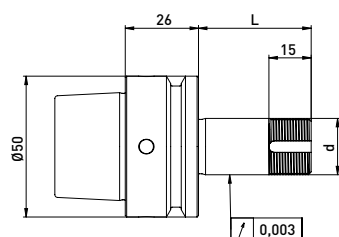


For Reinecker tool grinding machines with ring set $\varnothing 50$ mm

GWA HSK50 // ø20 mm // without RS

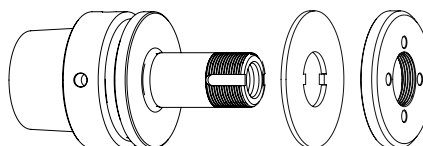

Technical drawing of a shaft-hub assembly. The drawing shows a shaft with a diameter of $\varnothing 50$ and a length of L . The shaft is inserted into a hub with a bore diameter of $\varnothing 50$. The hub has a total length of 26 and a section with a length of 15. A surface finish symbol indicates a maximum roughness of $R_a = 0,003$ on the shaft surface.

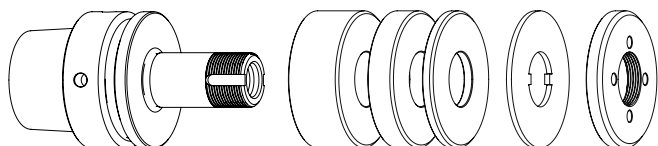

Delivered equipped:
Lock washer and clamping nut

Order No.	HSK	d	L	B 20	B 10	B 4
300072012	HSK50	20	40	-	1	4
300072022	HSK50	20	60	1	1	4
300072032	HSK50	20	85	2	2	3
300072042	HSK50	20	110	3	2	4
300072052	HSK50	20	25	-	-	3
300072062	HSK50	20	50	1	1	2
300072072	HSK50	20	75	2	1	3

Order No.	HSK	d	L
300072011	HSK50	20	40
300072021	HSK50	20	60
300072031	HSK50	20	85
300072041	HSK50	20	110
300072051	HSK50	20	25
300072061	HSK50	20	50
300072071	HSK50	20	75

Order No.	Name	
350050010	Universal assembly device ø50	
350040010	*Clamping nut wrench PC27 for ø20	
350040011	*Clamping nut wrench PC27 for ø20	
350020021	*Balancing weight pair for clamping nut ø50 // 100gmm	



Order No.	Name
250000253	Clamping screw Reinecker L40 - ø12 x 116
250000254	Clamping screw Reinecker L60 - ø12 x 136
250000255	Clamping screw Reinecker L85 - ø12 x 161
250000256	Clamping screw Reinecker L110 - ø12 x 186


Order No.	Name	
350011020	Spacer ring ø50 x ø20 x 20	
350011010	Spacer ring ø50 x ø20 x 10	
350011004	Spacer ring ø50 x ø20 x 4	
350015003	Support washer ø50 x ø75 x ø20 x 6	
350030010	Lock washer ø50 x ø20 x 2	
350020060	Clamping nut ø50 x 6 x M20 x 1 PC27	
350020020	* Clamping nut with balancing option ø50 x 8,5 M20 x 1,0 PC27	

Reinecker

Reinecker HSK50 // Shaft $\varnothing 31,75$ mm (1¼) // RS $\varnothing 60$ mm


For Reinecker tool grinding machines with ring set $\varnothing 60$ mm

GWA HSK50 // $\varnothing 31,75$ mm (1¼) // RS $\varnothing 60$ mm

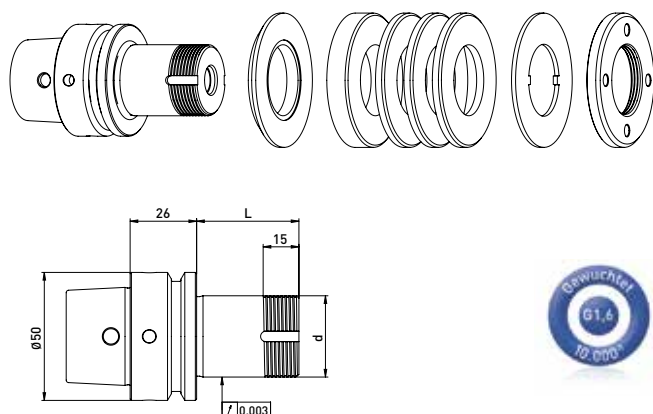

Delivered equipped:
Ring set $\varnothing 60$ mm, lock washer and clamping nut

GWA HSK50 // $\varnothing 31,75$ mm (1¼) // ohne Ringsatz

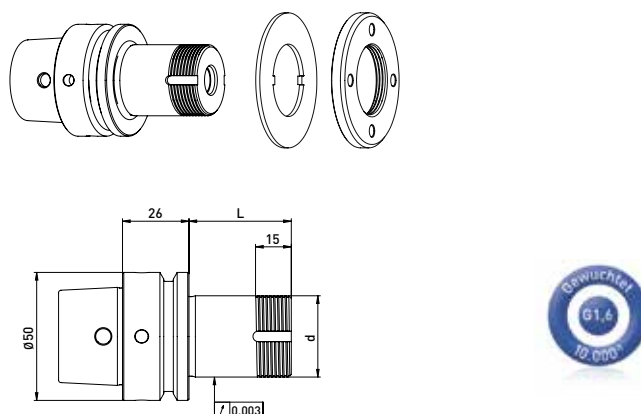

Delivered equipped:
Lock washer and clamping nut

Ringsatz $\varnothing 60$ mm

Best.-Nr.	HSK	d	L	B 20	B 10	B 4
300072112	HSK50	31,75	40	-	2	3
300072122	HSK50	31,75	60	1	1	3
300072132	HSK50	31,75	85	2	2	4
300072142	HSK50	31,75	100	3	2	3

Best.-Nr.	HSK	d	L
300072111	HSK50	31,75	40
300072121	HSK50	31,75	60
300072131	HSK50	31,75	85
300072141	HSK50	31,75	100

Accessories Reinecker grinding wheel adapter HSK50 // $\varnothing 31,75$ mm (1¼) // Ringset $\varnothing 60$ mm

Best.-Nr.	Bezeichnung
350050010	Universal assembly device $\varnothing 50$
350040030	*Clamping nut wrench TK39 for clamping nut with blancing option
350040020	Clamping nut wrench PC45 for $\varnothing 32$
350020023	*Balancing weight pair for clamping nut $\varnothing 60$ // 200gmm



Order No.	Name
250000253	Clamping screw Reinecker L40 - $\varnothing 12$ x 116
250000254	Clamping screw Reinecker L60 - $\varnothing 12$ x 136
250000255	Clamping screw Reinecker L85 - $\varnothing 12$ x 161
250000256	Clamping screw Reinecker L110 - $\varnothing 12$ x 186

Best.-Nr.	Bezeichnung
350011420	Spacer ring $\varnothing 60$ x $\varnothing 31,75$ x 20
350011410	Spacer ring $\varnothing 60$ x $\varnothing 31,75$ x 10
350011404	Spacer ring $\varnothing 60$ x $\varnothing 31,75$ x 4
350015009	Support washer
350030060	Lock washer $\varnothing 60$ x $\varnothing 32$ x 1,8
350020066	Clamping nut $\varnothing 60$ x 6 x M32 x 1,5 PC45
350020022	*Clamping nut with balancing option $\varnothing 60$ x 9 M32 x 1,5 PC39